

+5.2 DC Volt power supply setup



1. Turn applicator A/C power off.
2. Remove top cover.
3. With a volt meter set to meter to 20 Volts DC put the **Black Lead to J2 – pin 5** and the **Red Lead to J2 -pin 3** on power supply. (See figure 1)
4. Turn A/C power on.
5. Check voltage on voltmeter it should be 5.2 volts.
6. If it doesn't read 5.2 volts turn potentiometer with a small screw driver Clockwise for higher voltage setting and Counter Clockwise for lower voltage setting.
7. Turn A/C power off.
8. Replace top cover.

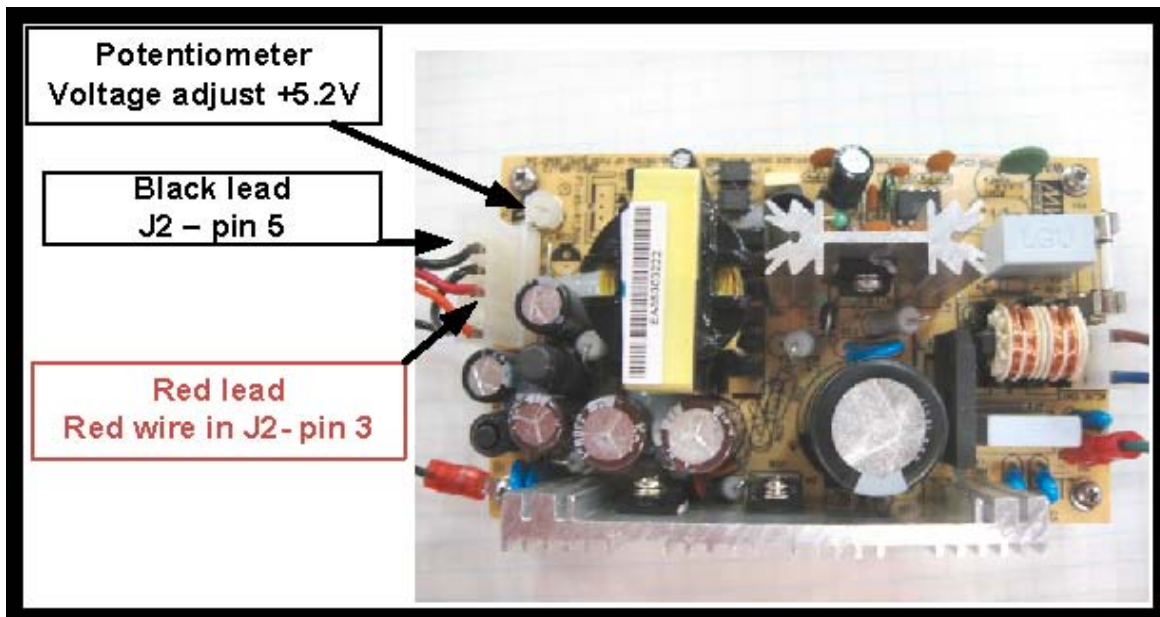


Figure 1 DC Power Supply

for parts and service call QLC, Inc. (800) 837-1309